T	MC SPECIFICA	ATION	NO. 5	039
REV: ØA				
COMPILED: BN	CHECKED:	APPD:	SHEET	of 8
TITLE:		1//	22/65	
typed by v	rab 11/18/65			

TEST PROCEDURE

FOR

THE TMC MODEL CSS-3B

PARTS 1

å

PARTS 2

TMC FORM SPEC 1

TM	IC SPECIFICA	ATION		NO. 5 10	39	
REV: A						
COMPILED: BN	CHECKED:	APPD:		SHEET 2	OF	8
TITLE: TEST PROCEDUR	E FOR THE TMC MODEL	CSS-3B	PART 1			
typed by vab 11/	18/65					

I. Test Equipment Required:

- A. Ballantine model 314 AC VTVM or equivalent.
- B. 47 ohm non-inductive resistor 1/2 watt.
- C. Simpson model 260 multi-meter or equivalent.

II. Preliminary:

- 1. Inspect unit for obvious mechanical imperfections.
- 2. Inspect unit for obvious wiring errors.
- 3. Check for proper orientation of transistors. The index tab on the transistor should match the keyway on the socket. All transistor sockets should be mounted with the keyway toward the rear of the unit.
- 4. Make sure that the terminal board is screwed down securely; if not, the unit will not operate properly.
- 5. Alarm switch, S605, to external position.
- 6. Connect unit to 115VAC power source. Check operation of I601 and I602.
 - a. STANDBY position; I601 should be on.
 - b. POWER-ON position; I602 should be on.
- 7. Check voltage across CR601. A value of 27 VDC + 10% should be obtained.
- 8. Disconnect 115VAC power source from J605.

III. Testing of the CSS-3B:

- 1. Install Frequency Test Std. into socket Z602.
- 2. Connect unit to 115VAC power source.
- 3. Set switch S601 to ON position.
- 4. Allow unit to warm up. (Approximately 30 minutes)
- 5. Check voltage at CR601. A minimum value of 24.3VDC shall be obtained.
- 6. Ch ck the output of th Fr qu ncy T st Std. at C612 with an AC VTVM. Voltag should b 1.4 VAC, + 10%.

TM	C SPECIFICAT	ON	NO. 5 10 39
REV:			
COMPILED: BN	CHECKED:	APPD:	SHEET 3 OF 8
TITLE: TEST PROCEDU	RE FOR THE CSS-3B	PART 1	
typed by vab	11/18/65		

- 7. Connect 47 ohm load at J602.
- 8. Connect AC VTVM to arm of R617. Adjust R617 for 1 wolt AC.
- 9. Check the following DC voltages with the Multi-meter.
 - (a) Q601 Pin 1 to ground and Q602 Pin 1 to ground. (Green leads). Tolerance + 0.1 VDC.
 - (b) Q601 Pin 2 to ground and Q602 Pin 2 to ground. (Yellow leads). Tolerance + 0.1 VDC.
- 10. Connect the AC VTVM to J602. Tune T603 for Maximum peak. Start with slug all the way out to avoid wrong peak.
- 11. The output of the CSS-3B should be at least .8 VAC at this point.
- 12. Readjust R617 for 1.0 VAC at J602.
- 13. Place the AC VTVM probe on the yellow dot terminal of Z601 Tune Z601 for maximum. (Start with slug all the way out to avoid wrong peak).
- 14. Place R616 sensitivity control to maximum. Adjust R614 phase detector Bal. for a 0 center scale reading of M601. When this has been accomplished the modulators are balanced.
- 15. If step #14 is performed correctly, then with R616 at minimum sensitivity, M601 should still read 0.
- 16. To check phase comparator circuit connect a stable external lmc signal (1 volt max.) to J604 connector on CSS-3, 3A, 3B. Phas comparator Meter will vary in accordance with phase relationship between CSS under test and the external 1 MC signal.
- 17. Check that S605, external-internal alarm is in the external position.
- 18. Connect the CA480-3-12, provided in KIT-270, from J602, Int. Std., to J3, Int. In.
- 19. Connect the external 1 MC 1.0 V source to J1, Ext. In.
- 20. Conn ct th 47 ohm load to J2, Out.
- 21. Connect the VTVM across J602, INT STD Meter should read 1.0 Volt.
- 22. Turn R1 counter-clockwise. Turn R1 counter-clockwise.

THE STATE OF THE S

			TN	AC	S	PE	EC	IF	TC	A	TIC		l			·	N	o. s	103	9	,		
REV:	Α																						
COMPILED:	BN			CI	HEC	KED:	:					API	PD:				SI	HEET	4		OF	8	
TITLE:		rest	PROC	EDU	RE	FOR	TH	Œ C	SS.	- 3B		1	PAR'	r 1					-				

- 23. Connect the multimeter, RX1 scale, across terminals 8 and 9. The meter should read short.
- 24. Turn R1 slowly clockwise until the multimeter reads open. Check to see that the VTVM still reads 1.0 Volt.
- 25. Using R617, reduce the level of the 1.0 MC output until the multimeter reads short again. The VTVM must not read below 0.707 Volts.
- 26. Raise the level of the 1.0 MC output to 1.0 Volt. The multimeter should read open at 1.0 Volt.
- 27. A slight readjustment of R1 may be necessary to have the multimeter read open at 1.0 Volt. Repeat steps 25 and 26.
- 28. Set R617 to have the VTVM read 1.0 Volt and lock R617 and R1.
- 29. Connect the AC VTVM across the load.
- 30. With 1.0 V applied to J3, the AC VTVM should read 1.0 V. On TB1, terminal 9 and 10 should be shorted, Terminal 8 and 9 should be open. On TB601, terminal 1 and 2 should be open.
- 31. Disconnect the cable from J3.
- 32. The AC VTVM should still read 1.0 V. On TB1, terminal 8 and 9 should be shorted, terminal 1 and 2 should be open. On TB601, terminal 1 and 2 should be shorted.
- 33. Place S605, EXTERNAL-INTERNAL ALARM to the INTERNAL position. The ALARM should sound and the light should light.
- 34. Replace the cable on J3. The ALARM should cease and the light should go out.
- 35. The CSS-3B is now ready for the stability test of the 1 MC Frequency Standard.

1	MC SPECIFICA	TION	NO. 5 1039	
REV: ØA				
COMPILED: BN	CHECKED:	APPD:	SHEET 5 OF	8
TITLE: TEST PROCED	URE FOR THE CSS-3B	PART 1		
typed by vab	11/18/65			
	TECHNICAL MATER			

CSS-3B TEST DATA SHEET PART

SERIAL NO.	MODEL NO.
MFG. NO.	
READINGS	
Voltage at CR601, unloaded.	VOLTS
Voltage at CR601, loaded.	VOLTS
Q601 pin 1Q602 pin 1.	VOLTS
Q601 pin 2Q602 pin 2.	VOLTS
Output at J602.	VOLTS
ALARM Circuit	OK
Switchover Voltage, Low point	VOLTS
DAME	
DATE	

TMC FORM SPEC 1

TM	C SPECIFICA	TION	NO. 5 \ D 3 5
REV: Ø A			
COMPILED: BN	CHECKED:	APPD:	SHEET 6 OF 8
TITLE: TEST PROCEDUR	E FOR THE CSS-3B	PART 2	
typed by vab	11/18/65		

I. TEST EQUIPMENT REQUIRED:

- A. Ballantine MO. 314 AC VTVM or equivalent.
- B. 47 Ohm carbon 1/2 watt resistor.
- C. Dumont MO. 304 oscilloscope or equivalent.
- D. Montronics Frequency Error Multiplier FEM-1 or equivalent.
- E. Rustrak MO. A recorder.
- F. Hewlett Packard reference Frequency Standard MO. 103AR.

II. PRELIMINARY:

- 1. Record the dates and serial numbers of the XTAL standards as they are received.
- 2. Plug NF-105 or NF-109 into Z602.
- 3. Record serial number of CSS-3 that the XTAL standard was installed in.
- 4. Connect 47 Ohm load to J602.
- 5. Turn unit on.
- 6. Record Date and time that unit was turned on.
- 7. Allow unit to warm up for one hour.

III. PRELIMINARY TEST:

- 1. Check output of 1 MC standard at C612 with Ballantine meter, the voltage should be 1.4V ± 10%.
- 2. Connect oscilloscope to C612, the sine wave output should not have more than 20% distortion.
- 3. Connect oscilloscope to J602, the output should be an undistorted sine wave.
- 4. Connect Ballantine meter to the same point and adjust R617 for 1 V output.

TM	C SPECIFICA	TION	NO. S \ 039
REV: ØA			
COMPILED: BN	CHECKED:	APPD:	SHEET 7 OF 8
TITLE: TEST PROCEDU	RE FOR CSS-3B	PART 2	
typed by vab 11	./18/65		

IV. 1 MEGACYCLE SETTING

- 1. Remove 47 Ohm load.
- 2. Turn CSS-3Bon for 24 hours to stabilize. (Do not record)
- 3. Connect J602 to TEST INPUT of frequency error multiplier (FEM-1) with a cable using a "T" connector on the TEST IMPUT jack.
- 4. Connect 47 Ohm load to open side of "T" connector.
- 5. Turn MULTIPLIER switch to position 10 and SCALE FACTOR switch to position 1, on FEM-1.
- 6. Remove cap from NF-105 or NF-109 unit.
- 7. Using screwdriver end of JFD adjustment tool 5484, adjust NF-105 or NF-109 standard so that the RUSTRAK recorder needle is at zero.
- 8. Turn SCALE FACTOR switch to .5 position and repeat step 7.
- 9. Turn MULTIPLIER switch to position 100 and repeat step 7.
- 10. Turn MULTIPLIER switch to 1K position and repeat step 7.
- 11. Turn MULTIPLIER switch to 10K position and repeat step 7.

V. STABILITY RUN

- 1. Turn on Recorder.
- 2. Allow RUSTRAK chart to record for 24 hours.
- 3. The unit should maintain a stability of one part in 10^8 for this period.
- 4. Record on chart, the date, time, serial number of CSS-3 and NF-105 or NF-109.
- 5. Record in book whether the unit was accepted or rejected.
- 6. Accepted CRYSTAL STANDARDS remain in the CSS-3B. The final insp ction stamp must appear on accepted standard and recorded chart.

ا ۵ امدا	I N	IC SPEC		11014		T	 	1,,0, 3	10	<u> </u>
ØA										
ILED:	BN	CHECKED:		APPD:				SHEE	г 8	OF
e: Test	PROCEDUR	e for the cs	S=3 B	PAR	T 2					
typed b	y vab	11/18/65			M					
			MAMARON	RIEL CORPO		ī				
		CSS -3B	TEST DA	TA SHEET P	ART 2					
SERIAL	NO				MODEL	NO				
VMO W										
MFG. NO)•									
PRELIM	INARY									
				_						
De	ite	Time_ C612 t C612		Volts.	urned	On.				
Wa	reform s	C612 t C612 t J602 or J6		OK.						
Wa	veform a	t J602 or J6	06		OK.					
		J602 or J606			_Volts	.				
1 MEGAC	YCLE SET	TING AND STA	BILITY R	UN						
Wa	irmup per:	iod 24 hours	.			OK				
Ch	art Reco	rder/				OK				
St	andard in	nitial adjus	tments							
Ch	art Reco	rder 24 hour	·s			_ok				
		in 24 hours_		·		_OK				
S€	rial num	ber of accep	ted stan	dard						

TMC FORM SPEC 1

TESTER

REVIS	ION	SHEET	•	THE TECHNICAL MATERIEL CORP. MAMARONECK NEW YORK	S 1039	
DATE	REV.	SHEET	EMN #	DESCRIPTION		APP
11-22-		JANEE!		ORIGINAL RELEASE FOR PRODUCTION		
		a11	15/5/	Revised per EMN	0	8
.2/15/6	<u>Э А</u>	all	13434	Revised per Min		
						1
		†				
			<u> </u>			
			 			1
			 			
			1			
····			-			
			<u> </u>			
			-			-
			ļ	•		
						-
			<u> </u>			-
	ļ		<u> </u>			+
						<u> </u>
						ļ
	1					
•						
····	+					
	1	1	1			
	 					
	1					
	1		-			
	+		1			1
		_	+			1
	+	-				
	1		 			
	-					+
						